
UL/cUL SYSTEM NO. HW-D-0930

FIRE-RATED JOINT THROUGH CONCRETE WALL OR BLOCK WALL ASSEMBLY

ASSEMBLY RATING = 2-HR.

CLASS II MOVEMENT CAPABILITIES - 12.5% COMPRESSION OR EXTENSION
L-RATING AT AMBIENT = LESS THAN 1 CFM / LIN FT
L-RATING AT 400°F = LESS THAN 1 CFM / LIN FT

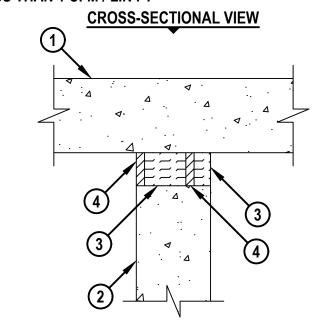

CONFIGURATION A

CONFIGURATION B

- 1. CONCRETE FLOOR ASSEMBLY (2-HR. FIRE-RATING) :
 - A. LIGHTWEIGHT OR NORMAL WEIGHT CONCRETE FLOOR (MINIMUM 4-1/2" THICK).
 - B. ANY UL/cUL CLASSIFIED PRECAST (HOLLOW-CORE) CONCRETE FLOOR (MINIMUM 6" THICK).
- 2. CONCRETE WALL ASSEMBLY (2-HR. FIRE-RATING):
 - A. LIGHTWEIGHT OR NORMAL WEIGHT CONCRETE WALL (MINIMUM 4-1/2" THICK).
 - B. ANY UL/cUL CLASSIFIED CONCRETE BLOCK WALL.
- 3. MINERAL WOOL SAFING (MIN. 4 PCF DENSITY) COMPRESSED 50% (SEE TABLE BELOW). FOR CONFIGURATION B, INSTALL MINIMUM 1" THICKNESS MINERAL WOOL FLUSH WITH INACCESSIBLE SIDE OF WALL.
- 4. HILTI CP 606 FLEXIBLE FIRESTOP SEALANT (SEE TABLE BELOW).

MAX JOINT WIDTH	MIN THICKNESS OF MINERAL WOOL INSTALLED BETWEEN LAYERS OF SEALANT	MIN DEPTH HILTI CP 606
2"	2"	1/2"
1"	2-1/2"	1/4"



HILTI, Inc. Plano, Texas USA (800) 879-8000

Sheet	1 of 1
Scale	11/64" = 1"
Date	May 17, 2021

HWD 0930a

Saving Lives through Innovation and Education

HWD0930a.051721